


B2N45H-Q20L60-2LI2-H1151/S97



Inclinometer – With Increased Temperature Range

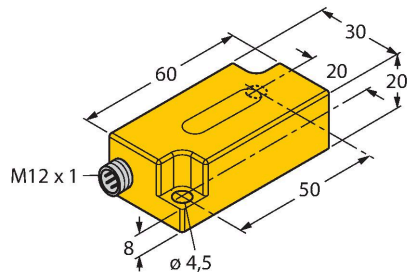

Features




- Plastic, PC
- For temperatures up to - 40 °C
- Zero point calibration +/- 15°
- Two analog outputs
- M12 x 1 male connector

Wiring diagram

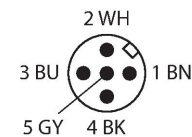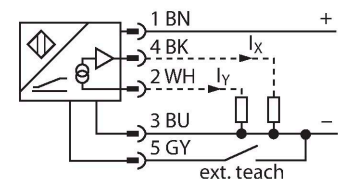

Functional principle

Inclination is determined by a wear-free semiconducting sensor element.

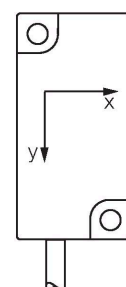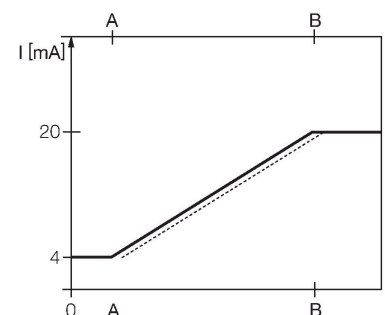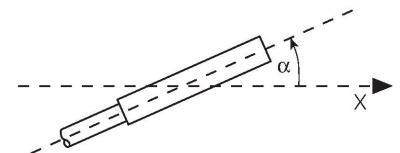

Technical data


Type	B2N45H-Q20L60-2LI2-H1151/S97
ID	1534037
Measuring principle	Acceleration
General data	
Measuring range	-45...45 °
Measuring range x-axis	-45...45 °
Measuring range y-axis	-45...45 °
Number of measuring axes	2
Repeatability	≤ 0.2 % of measuring range A - B
Linearity deviation	≤ 0.5 %
Temperature drift	≤ ± 0.04 %/K for temperature range between -40 °C and +85°C
Resolution	≤ 0.1 °
Electrical data	
Operating voltage U _B	10...30 VDC
Isolation test voltage	0.5 kV
Short-circuit protection	yes
Wire break/reverse polarity protection	no/yes
Output function	5-pin, Analog output
Current output	4...20 mA
Load resistance current output	≤ 0.2 kΩ
Response time	0.1 s time for the output signal to achieve 90% of full scale if the angle changes from -45° to +45°
Current consumption	50 mA

Technical data

Mechanical data	
Design	Rectangular, Q20L60
Dimensions	60 x 30 x 20 mm
Housing material	Plastic, PC
Electrical connection	Connector, M12 × 1
Environmental conditions	
Ambient temperature	-40...+70 °C
Vibration resistance	55 Hz (1 mm)
Shock resistance	30 g (11 ms)
Protection class	IP68 IP69K
MTTF	203 years

Mounting instructions

Mounting instructions/Description

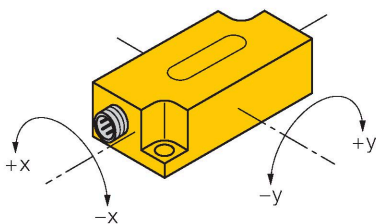


Teaching
The zero point can be adjusted with teach adapter TX1-Q20L60.
Teach-GND is pressed for approx. 1 s to do this. The outputs are switched to 20 mA as confirmation.
Teach-GND is pressed for 6 s to reset the axis zero points. The outputs are switched to 4mA as confirmation.
Once the teach button is released, the sensor returns to normal operation.


Accessories

GUARD-Q20L60 A9684

Protective housing for Q20L60 inclinometers for protecting against mechanical impact; material: Stainless steel

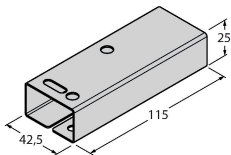

Accessories

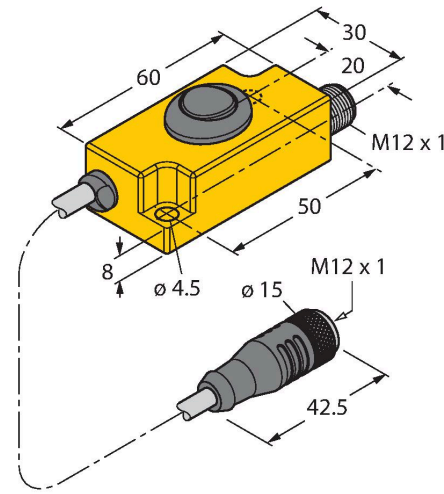Dimension drawing	Type	ID	
	TX1-Q20L60	6967114	Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors