


# RU200-CK40-2UN8X2T-H1151 Ultrasonic Sensor – Diffuse Mode Sensor



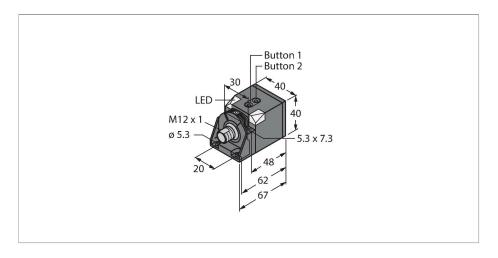


# Technical data


Туре	RU200-CK40-2UN8X2T-H1151		
ID	1610057		
Ultrasonic data			
Function	Proximity switch		
Range	502000 mm		
Resolution	1 mm		
Minimum switching range	20 mm		
Ultrasound frequency	120 kHz		
Repeat accuracy	≤ 0.25 % of full scale		
Edge lengths of the nominal actuator	100 mm		
Approach speed	≤ 3 m/s		
Pass speed	≤ 3 m/s		
Electrical data			
Operating voltage U <sub>B</sub>	1530 VDC		
Residual ripple	10 % U <sub>ss</sub>		
DC rated operating current I <sub>e</sub>	≤ 150 mA		
No-load current	≤ 50 mA		
Load resistance	≤ 1000 Ω		
Residual current	≤ 0.1 mA		
Response time typical	< 160 ms		
Readiness delay	≤ 300 ms		
Output function	NO/NC, NPN		
Output 1	Switching output		
Output 2	Switching output		
Switching frequency	≤3 Hz		
Hysteresis	≤ 20 mm		
Voltage drop at I <sub>e</sub>	≤ 2.5 V		

### **Features**

- Separate transducers for transmitter and receiver
- ■Rectangular housing 40 x 40 mm
- Connection via M12 x 1 male
- ■Teach range adjustable via button
- ■Blind zone: 5 cm
- Range: 200 cm
- ■Resolution: 1 mm
- ■Aperture angle of sonic cone: ±60 °
- ■2 x switching outputs, NPN
- ■NO/NC programmable

# Wiring diagram

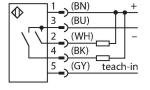

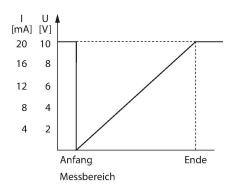



### Technical data

Short-circuit protection	yes/Latching
Reverse polarity protection	yes
Wire breakage protection	yes
Setting option	Remote Teach
Mechanical data	
Design	Rectangular, CK40
Radiation direction	straight
Dimensions	67 x 40 x 40 mm
Housing material	Plastic, PBT-GF30-V0
Electrical connection	Connector, M12 × 1, 5-wire
Ambient temperature	0+70 °C
Pressure resistance	0.55 bar
Protection class	IP40
Switching state	LED, Yellow
Object detected	LED, Green
Tests/approvals	
Declaration of conformity EN ISO/IEC	EN 60947-5-2
Vibration resistance	20 g, 1055 Hz, sine, 3 axes, 30 min/axis according to IEC 60068-2-6
Shock test	30 g, 11 ms, half sine, 3 axes according to IEC 60068-2-27
Approvals	CE cULus


# Functional principle

Ultrasonic sensors capture a multitude of objects contactlessly and wear-free with ultrasonic waves. It does not matter whether the object is transparent or opaque, metallic or non-metallic, firm, liquid or powdery. Even environmental conditions such as spray, dust or rain hardly affect their function.


The sonic cone diagram indicates the detection range of the sensor. In accordance with standard EN 60947-5-2, quadratic targets in a range of sizes ( $20 \times 20$  mm,  $100 \times 100$  mm) and a round rod with a diameter of 27 mm are used.

Important: The detection ranges for other targets may differ from those for standard targets due to the different reflection properties and geometries.

#### Sonic Cone

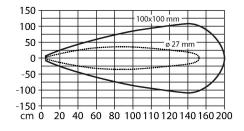


# Output behaviour

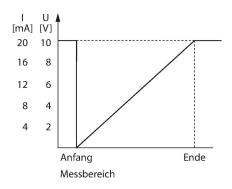

# Mounting instructions

#### Mounting instructions/Description

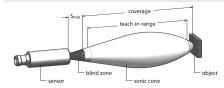

#### Setting the limits

The ultrasonic sensor features two switching outputs with teachable switching range. The range is either set via Easy-Teach or via the buttons on the housing. The green and yellow LED indicate whether the sensor has detected an object.

Various functions such as single switchpoint, window mode or reflection mode to a fixed



target can be taught. Further information is described in the operating instructions. How to set the window mode is described below. The limits of the window may be selected freely within the detection range.

#### Easy-Teach

- •Connect teach adapter TX1-Q20L60 between sensor and connection cable
- •For the first limit value, place object accordingly
- Press and hold the select button for output 1 or 2 for 2 or 8 s against Gnd
- Press and hold the select button for 8 s against Gnd to teach the first limit value.
- •For the second limit value, place object accordingly
- •Press and hold button for at least 2 s against Gnd

#### Teach-Button

- •For the first limit value, place object accordingly
- Press and hold button 1 to select output 1 or 2 for 2 or 8 s against Gnd
- Press and hold button 1 for at least 8 s
   For the second limit value, place object accordingly
- Press and hold button 1 for at least 2 s

After successful teaching, the sensor automatically runs in normal operating mode. Unsuccessful teach-in is signalled by the LED flashing slowly at a frequency of 5Hz.

#### LED response

Successful teaching is indicated by a fast flashing green LED. Thereafter, the sensor automatically runs in normal operating mode. Unsuccessful teaching is indicated by the LED flashing alternately green and yellow. In normal operating mode both LEDs signal the switching state of output 1.

•green: object is in the detection range but not in the switching range

yellow: object is in the switching rangeoff: object is outside the switching range

# Accessories

	_		
Dimension drawing	Туре	ID	
M12x1 o 15	RKC4.5T-2/TEL	6625016	Connection cable, M12 female connector, straight, 5-pin, cable length: 2 m, jacket material: PVC, black; cULus approval
015 M12x1 26.5 32	WKC4.5T-2/TEL	6625028	Connection cable, M12 female connector, angled, 5-pin, cable length: 2 m, jacket material: PVC, black; cULus approval



# Accessories

Dimension drawing

Type

ID

TX1-Q20L60

6967114

Teach adapter for inductive encoders, linear position, angle, ultrasonic and capacitive sensors